


PS COVER STRIP

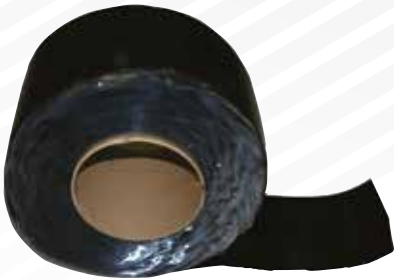

Pressure Sensitive (P.S.) Cover Strip will simplify your next FIX-R EPDM installation with Pressure Sensitive Cover Strip.

- Available in 152mm (6") by 30.5m (100') long
- As tough as the field membrane
- Fully cured state enables it to handle expansion and contraction loads without weakening
- Resists tearing, flex cracking and abrasion caused by temperature extremes, sunlight, precipitation and all forms of normal weathering

Description

PS Cover Strip is a nominal 1.52mm thick, cured EPDM membrane with a nominal 0.76 mm thick, fully cured, synthetic rubber pressure-sensitive adhesive.

Intended Uses

PS Cover Strip is designed for stripping in seams & metal edgings, splicing to other roof systems (PVC/TPO/GRP/Metal Systems), sealing end laps of FleeceBack systems or simply making repairs to cut membrane. PS Cover Strip must be used in conjunction with FIX-R EPDM Primer.

Application*

- 1 The entire surface where the PS Cover Strip will be applied must be clean. The adhesive on the back of the PS Cover Strip will not adhere to dusted/dirty surfaces. Any residual contamination will be detrimental to the bond strength of the adhesive.
- 2 Remove dirt and excess dust from the splice area by wiping with a clean rag. If necessary, clean the splice area thoroughly with Weathered Membrane Cleaner. This process is essential on membrane that has been exposed for a number of weeks.
- 3 Application of FIX-R EPDM Primer: Apply the primer to the area of the membrane to be flashed with a scrubbing pad. The coated area will be free of globs or puddles.
- 4 Allow the primer to dry until it does not transfer to a dry finger touch. Install PS Cover Strip immediately to minimize potential dust contamination and promote adhesion in colder weather.
- 5 Peel off 250 - 305mm (10-12") of the protective release liner from the PS Cover Strip. Position the cover strip over the area to be covered and press down the exposed tape adhesive using firm, even hand pressure across the entire area. Continue this process until the full area to be flashed is completed.
- 6 Immediately roll the PS Cover Strip with a (2" 50mm) wide steel roller. Roll across the cover strip edge, not parallel to it.

- 7 Apply Lap Sealant at overlaps in PS Cover Strip or at joints in the metal edging according to the appropriate detail.
- 8 To achieve proper adhesion of the PS Cover Strip when jobsite temperatures fall below 5°C, heat the primed area of the membrane with a hot-air gun as the flashing is applied and pressed into place.

*REVIEW CURRENT SPECIFICATIONS AND DETAILS FOR SPECIFIC APPLICATION REQUIREMENTS.

Precautions

- 1 Avoid prolonged contact with skin. In case of contact with skin, thoroughly wash affected area with soap and water.
- 2 Prolonged jobsite storage temperatures in excess of 32°C may affect product shelf life.
- 3 In warm, sunny weather, keep FIX-R PS Cover Strip rolls in their box or in a shaded area until ready to use.
- 4 PS Cover Strip must be stored in a dry area.
- 5 Storage and use of PS Cover Strip at temperatures below 4°C will result in a loss of adhesive tack and, in extreme cases, will result in no bond to the substrate. Overnight storage must be available to keep the temperature of the PS Cover Strip at a minimum of 15°C. Hot boxes for jobsite storage must be provided to maintain a minimum product temperature of 4°C.
- 6 For sealing to aged roof systems, neighbouring surfaces must be thoroughly cleaned of all dirt, debris, dust, grease, oils etc. before application of primer and tape.
- 7 Due to solvent flash-off, condensation may form on applied primer when the ambient temperature is near the dew point. If condensation develops, the application of primer and PS Cover Strip must be discontinued as proper adhesion will not be achieved. Allow the surface to dry before applying a thin coat of primer and PS Cover Strip to the previously coated surface.
- 8 PS Cover Strip is cured and cannot be used for flashing corners or pipes.
- 9 Do not allow waste products (petroleum, grease, oil, solvents, vegetable or mineral oil, animal fats, etc.) or direct steam venting to come in contact with the PS Cover Strip.

10 KEEP OUT OF THE REACH OF CHILDREN.

FIX-R PS Cover Strip

Typical Properties & Characteristics*

Colour	Black
Base Membrane Adhesive	EPDM Synthetic Rubber
Solids	100%
Tensile Strength	1650 psi (11.3Mpa) min.
Elongation	480% min.
Ozone Resistance Condition after exposure to 100 pphm Ozone in air for 168 hrs. @ 40°C (Specimen under 50% strain)	No Cracks
Brittleness Temp.	-55°C
Nominal Thickness	2.29mm
Nominal Width Membrane Adhesive	150mm 155mm
Roll Size	152mm x 30.5m long
Shelf Life	1 year
Weight	14 kg
Packaging	Per roll

*Typical properties and characteristics are based on samples tested and are not guaranteed for all samples of this product. This data and information is intended as a guide and does not reflect the specification or specification range for any particular property of this product.

Before using this product please ensure that you have been supplied with and have read carefully the following information:

- 1 The product labels
- 2 FIX-R PS Cover Strip Material Safety Data Sheet

Date of issue: Mar 19